

# **Quick Start Guide Koncentrik V2 APC**




## General information:

- No focus adjustment: it's normal to see a blurry spot of light.
- Do a complete 360° turn of the connector during measurement.
- Holder must be well adjusted for connector (smooth unforced insertion but without any play)
- ! - Connector plugged to the light source must be well aligned with light beam and well held.
- Keep the focal plan unchanged during the rotation, so be sure that the connector is always fully inserted inside the holder.

## Connect to external power supply light source



## Check picture you need to have

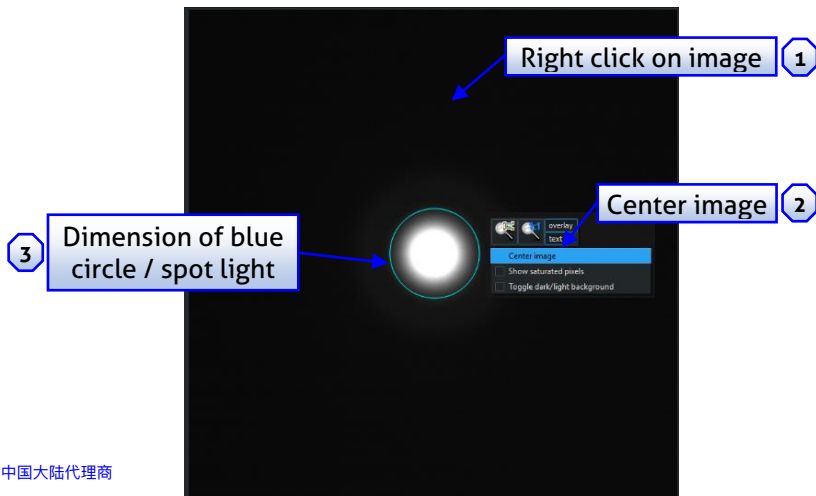

中国大陆代理商

深圳市谱兆通讯设备有限公司

Tel: +86-755-8665-5448; +86-755-8665-5579; Email: info@pztest.com Website: www.pztest.com